SITE SURVEY REPORT

LOLER Thorough Examination Record

Prepared for	Midlands Fabrication Ltd
Date	6 Oct 2026
Site	Midlands Fabrication
Prepared by	H. Briggs

FORM

LOLER Thorough Examination Record

1. Examination

Project	Midlands Fabrication: six-monthly LOLER examinations (completed example)
Client	Midlands Fabrication Ltd
Site	Unit 9, Canal Works
Site address	Canal Works, Tipton
Examination date	6 Oct 2026
Competent person (examiner)	H. Briggs
Company	Lift Safe Inspections
Employer the report is for	Midlands Fabrication Ltd
Employer address	Unit 9, Canal Works, Tipton

> LOLER regulation 9: where lifting equipment is exposed to conditions that cause deterioration liable to result in dangerous situations, it must be thoroughly examined at least every 6 months if it lifts people or is a lifting accessory, at least every 12 months for other lifting equipment, or in line with an examination scheme drawn up by a competent person. It must also be examined each time exceptional circumstances liable to affect its safety have occurred, and, where its safety depends on how it is installed, after installation and before first use.

2. Equipment

Equipment by building or area 1: Bay 1

Building or area	Bay 1

Equipment examined here 1: OHC-01

Identification or asset number	OHC-01
Type	Overhead crane
Position in this area	Bay 1
Safe working load	5 t
Date of manufacture (if known)	2011
Date of the last thorough examination	7 Oct 2025

Days since the last thorough examination	364
Used to lift people?	No
Examination	Every 12 months
Result	Safe to use
Latest date for the next thorough examination	6 Oct 2027
Days from this examination to the next	365

Photos



Equipment examined here 2: CH-14


Identification or asset number	CH-14
Type	Lifting accessory (sling, shackle, eyebolt)
Position in this area	Rack
Safe working load	2 t
Date of manufacture (if known)	Not known
Date of the last thorough examination	8 Apr 2026
Days since the last thorough examination	181
Used to lift people?	No
Examination	Every 6 months
Result	Dangerous defect: do not use

Defects found and repairs needed	Hook safety catch missing and throat opened beyond the manufacturer's limit. Quarantined and tagged. Employer told at 09:40 on the day.

> Dangerous defect. The examiner must tell the employer straight away, and where there is an existing or imminent risk of serious personal injury, send a copy of the report to the enforcing authority as soon as practicable. The employer must make sure the equipment is not used until the defect is put right.

Latest date for the next thorough examination	6 Apr 2027
Days from this examination to the next	182

Photos

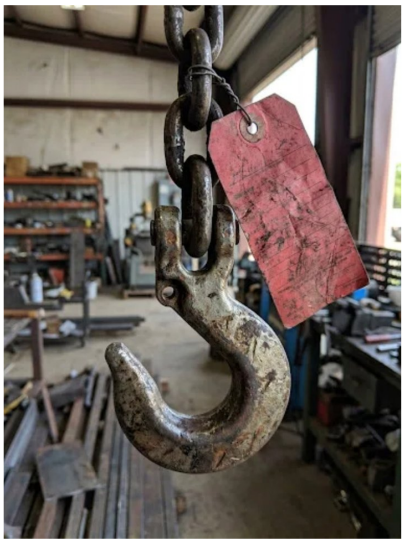

This building or area: items examined	2
This building or area: safe to use	1
This building or area: defects to fix by a set date	0
This building or area: dangerous defects	1
This building or area: overdue at this examination	0
This building or area: next date later than the interval	0

Equipment by building or area 2: Yard

Building or area	Yard

Equipment examined here 1: MEWP-02

Identification or asset number	MEWP-02
Type	MEWP

LOLER Thorough Examination Record

Position in this area	Yard
Safe working load	230 kg
Date of manufacture (if known)	2019
Date of the last thorough examination	8 Apr 2026
Days since the last thorough examination	181
Used to lift people?	Yes
Examination	Every 6 months
Result	Defect to fix by a set date
Defects found and repairs needed	Platform gate latch spring weak: the gate closes but does not always latch. Could become a danger if the gate opens at height. Replace the spring.
Fix by	20 Oct 2026
Days allowed to put it right	14
Latest date for the next thorough examination	6 Apr 2027
Days from this examination to the next	182

Photos



This building or area: items examined	1
This building or area: safe to use	0
This building or area: defects to fix by a set date	1
This building or area: dangerous defects	0

This building or area: overdue at this examination	0
This building or area: next date later than the interval	0

Equipment by building or area 3: Bay 2

Building or area	Bay 2


Equipment examined here 1: CB-03

Identification or asset number	CB-03
Type	Hoist
Position in this area	Gantry
Safe working load	1 t
Date of manufacture (if known)	2016
Date of the last thorough examination	2 Sep 2025
Days since the last thorough examination	399
Used to lift people?	No
Examination	Every 12 months

> The last thorough examination was more than 12 months before this one. On a 12-month basis (LOLER regulation 9(3)(a)(ii)) the equipment was overdue: record why, and whether it was used while overdue.

Result	Safe to use
Latest date for the next thorough examination	6 Oct 2027
Days from this examination to the next	365

Photos

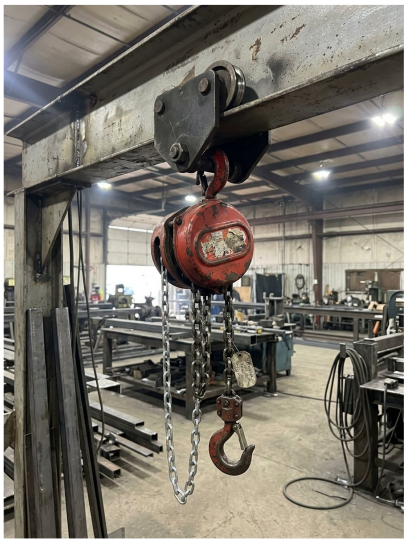

This building or area: items examined	1
This building or area: safe to use	1
This building or area: defects to fix by a set date	0
This building or area: dangerous defects	0
This building or area: overdue at this examination	1
This building or area: next date later than the interval	0
Items examined	4
Safe to use	2
Defects to fix by a set date	1
Dangerous defects	1
Overdue at this examination	1
Next date later than the interval	0

> At least one item has a dangerous defect. The examiner tells the employer straight away, and the employer makes sure it is not used until the defect is put right (LOLER regulation 10).

3. Declaration

> LOLER regulation 10: the examiner makes an authenticated written report containing the information in Schedule 1, as soon as practicable, for the employer and for anyone the equipment is hired or leased from. Schedule 1 includes the date of the report and the name and address of anyone signing or authenticating it for the examiner. This form is a site record of the examination; check every Schedule 1 item is present before it is issued as the report.

Examiner name	H. Briggs
Position	Engineer surveyor
Examiner qualifications	IEng, 12 years examining lifting equipment
Examiner signature	
Received for the employer by	D. Cole, works manager
Signature for the employer	